

TECHNICAL DATA

PTi120 Pocket Thermal Imager



The power of a professional-grade thermal imager that fits in your pocket.

- Continuous touchscreen IR-Fusion™, slide your finger across the screen to adjust the setting.
- Automatically organize and file thermal images with Fluke Connect™ Asset Tagging
- Fully radiometric thermal imager with 120 x 90 infrared resolution (10,800 pixels)
- 3.5" LCD touchscreen display for easy troubleshooting
- Can withstand drop up to 1 meter
- Water and dust resistant—IP54 enclosure rating
- -20 °C to 400 °C temperature measurement range

Rugged portable thermal camera for industrial inspection.



Small enough to carry every day without worry. Pocket sized. Stands up to dirt and water. Quick scans of electrical equipment, machinery and other assets.

PREMIUM IMAGE QUALITY

SPATIAL RESOLUTION
7.6 mRad

RESOLUTION
120 x 90

TEMPERATURE RANGE
-20 °C to 400 °C

ENCLOSURE RATING
IP54

IR-FUSION



The 3.5" LCD touchscreen offers IR-Fusion to blend a visible light image with an infrared image to more easily locate problems. Simply slide your finger across the screen to adjust the setting.



Eliminate hours at the computer organizing your thermal images, let Asset Tagging do all that work for you. No more dragging and dropping or renaming files in the office, just scan a QR code on your asset, capture your thermal images and they automatically are sorted by asset. Start spending your time analyzing your images and creating reports instead of sorting your files one at a time.

Specifications

Key features		PTi120
Infrared resolution		120 x 90 (10,800pixels)
IFOV (spatial resolution)		7.6 mRad, D:S 130:1
Field of view		50° H x 38° V
Minimum focus distance		50 cm
Focus system		Fixed focus
Data transfer		Mini USB used to transfer image to PC
Wireless connectivity		Yes
Fluke Connect Instant Upload		Yes, connect your camera to your building's WiFi network and images taken automatically upload to the Fluke Connect system or your local server for storage and viewing on your PC
Image quality		
IR-Fusion technology		AutoBlend continuous 0 % to 100 %. Yes, adds the context of the visible details to your infrared image
Display		3.5" LCD touchscreen (landscape)
Display resolution		320 x 240 LCD
Thermal sensitivity (NETD)		60 mK
Frame rate		9 Hz
Data storage and image capture		
Memory		≥ 2 GB internal flash memory
Image capture, review, save mechanism		One-handed image capture, review, and save capability
Image file formats		Non-radiometric (jpeg), or fully radiometric (.is2); no analysis software required for non-radiometric (jpeg) files
Software		Fluke Connect desktop software—full analysis and reporting software with access to the Fluke Connect system
Export file formats with software		.bmp, .dib, .jpg, .tif, .tiff
Battery		
Batteries (rechargeable)		Internal rechargeable lithium ion battery
Battery life		≥ 2 hours continuous (without WiFi)
Battery charging time		≤ 1.5 hours
Battery charging system		Micro USB port
AC operation		With separate AC to USB adapter Not included in box
Power saving		Automatic Shutdown: 5, 10, 15 and 20 minutes or never
Temperature measurement		
Temperature measurement range (not calibrated below 0 °C)		-20 ° C to 400 ° C
Accuracy		Target temp at or over 0 °C: Accuracy: ± 2° C or ± 2 % at 25°C, whichever is the greater.
On-screen emissivity correction		Yes via material selection
On-screen reflected background temperature compensation		Yes
Center-point temperature		Yes
Spot temperature		Hot and cold spot markers
Color palettes		
Standard palettes		6: Ironbow, Blue-Red, High Contrast, Amber, Hot Metal, Grayscale

Specifications continued

Key features	PTi120
General specifications	
Infrared spectral band	8 µm to 14 µm (long wave)
Operating Temperature	-10 °C to +50 °C
Storage Temperature	-40 °C to +70 °C
Relative humidity	95 % non-condensing
Safety	IEC 61010-1: Pollution Degree 2
Electromagnetic compatibility	EN 61326-1, CISPR 11: Group 1, Class A
US FCC	CFR, Part 15C
Vibration and shock	10 Hz to 150 Hz, 0.15 mm, IEC 60068-2-6; 30 g, 11 ms, IEC 60068-2-27
Drop	Engineered to withstand 1 meter drop
Size (H x W x L)	8.9cm x 12.7cm x 2.5cm
Weight	0.233 kg
Enclosure rating	IP54 (protected against dust, limited ingress; protection against water spray from all directions)
Warranty	Two-years (standard)
Supported languages	Czech, Dutch, Danish, English, Finnish, French, German, Hungarian, Italian, Japanese, Korean, Norwegian, Polish, Portuguese, Russian, Simplified Chinese, Spanish, Swedish, Traditional Chinese, and Turkish


Ordering information

FLK-PTi120 9HZ 400C 120 x 90 Thermal Imager; 9 HZ

Included

Infrared camera; USB cable; soft transport bag; adjustable lanyard. Available by free download: Fluke Connect software and user manual.

Visit your local Fluke website or contact your local Fluke representative for more information.

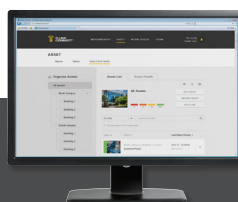

Share images from the field. Collaborate and report immediately.

Get the most out of your PTi120. Download Fluke Connect today. Save time by sending your images to the team while working in the field.

The Fluke Infrared Cameras are part of a growing system of connected test tools and equipment maintenance software.

Find out more at **fluke.com.au**



Fluke. *Keeping your world up and running.®*

Fluke Australia

Unit 16/7 Anella Avenue Castle Hill,
NSW, 2154 Australia
Phone: 1300 1 FLUKE (35853) Fax:
+61 2 8850 3300
Email: auinfo@fluke.com Website:
www.fluke.com.au

©2019, 2021 Fluke Corporation.
Specifications subject to change without notice.
05/2021 210536-6011963-en

**Modification of this document is not permitted
without written permission from Fluke Corporation.**